



PIARCO INTERNATIONAL NOTAM OFFICE

AIP SUPPLEMENT

Tele: 1 868 669-4128
1 868 668-8222 ext 2510
FAX: 1 868 669 1716
AFTN: TTPPYNYX
Email: aimpublication@caa.gov.tt

TRINIDAD & TOBAGO
CIVIL AVIATION AUTHORITY,
P.O. BOX 2163, NATIONAL MAIL CENTRE, PIARCO
REPUBLIC OF TRINIDAD AND TOBAGO

35/26
11 AUG 26

AD

35. A.N.R. ROBINSON INTERNATIONAL AIRPORT (TTCP)

Aerodrome Data Updated

Effective: 260811 to PERM

TTCP AD 2.8 APRONS, TAXIWAYS AND CHECK LOCATIONS DATA has been amended.

New information is identified by a change bar symbol located at the left margin where the change has occurred.

A new terminal building, apron and two (2) taxiways have been established at the A. N. R. Robinson International Airport. Seven (7) new parking positions are now available at the new terminal.

Please see **Attachment A** for the updated Aerodrome Chart for A. N. R. Robinson International Airport.

The following data published in the Eastern Caribbean AIP are required to be updated:

TTCP AD 2.4 HANDLING SERVICES AND FACILITIES (Page AD 2.10-2-2)

(Fueling facilities/capacity) updated to: 2 Refuelers capacity 13000 litres and 31000 litres; Fuel Hydrant Dispenser flow rate 2600 litres/min; Fuel Capacity 1500000 litres stored at Tank Farm offsite.

TTCP AD 2.5 PASSENGER FACILITIES (Page AD 2.10-2-2)

Tourist Office updated to: At East Terminal Building.

TTCP AD 2.8 APRONS, TAXIWAYS AND CHECK LOCATIONS DATA (Page AD 2.10-2-3)

Apron surface and strength:

EAST APRON

Type of Surface: Concrete

Strength: PCR 1053/R/B/W/T – Parking Positions 201-203 (Code E)

PCR 534/R/B/W/T – Parking Positions 204-209 (Code C)

WEST APRON

Type of Surface: Concrete

Strength: PCR 310/R/A/W/T – Parking Positions 1-4

PCR 913/R/A/W/T – Parking Positions 5-7



PIARCO INTERNATIONAL NOTAM OFFICE

AIP SUPPLEMENT

Tele: 1 868 669-4128
1 868 668-8222 ext 2510
FAX: 1 868 669 1716
AFTN: TTPPYNYX
Email: aimpublication@caa.gov.tt

TRINIDAD & TOBAGO
CIVIL AVIATION AUTHORITY,
P.O. BOX 2163, NATIONAL MAIL CENTRE, PIARCO
REPUBLIC OF TRINIDAD AND TOBAGO

35/26
11 AUG 26

Taxiway width, surface and strength:

TWY A Width: 45M; Type of Surface: Asphalt; Strength: PCR 780/F/A/W/T

TWY B Width: 40M; Type of Surface: Asphalt; Strength PCR 780/F/A/W/T

TWY C Width: 40M; Type of Surface: Asphalt; Strength PCR 780/F/A/W/T

TWY D Width: 23M; Type of Surface: Asphalt; Strength PCR 831/F/B/X/T

TWY E Width: 23M; Type of Surface: Asphalt; Strength PCR 831/F/B/X/T

TTCP AD 2.9 SURFACE MOVEMENT GUIDANCE AND CONTROL SYSTEM AND MARKINGS

(Page AD 2.10-2-3)

Markings: TWY: Centre line, All holding positions, Edge and Enhanced Centre line

Lights (LGT): TWY: TWY edge lights, RWY Designation and TWY location signage and Guard Lights (TWY D and E only).

TTCP AD 2.12 RUNWAY PHYSICAL CHARACTERISTICS (Page AD 2.10-2-5)

RWY 11 – PCR 731/F/A/W/T

RWY 29 – PCR 731/F/A/W/T

TTCP AD 2.15 OTHER LIGHTING, SECONDARY POWER SUPPLY (Page AD 2.10-2-6)

Please add the following:

TWY edge and centre line lighting: TWY D: Edge: blue, Centre line: NIL

TWY E: Edge: blue, Centre line: NIL

TTCP AD 2.20 LOCAL TRAFFIC REGULATIONS (Page AD 2.10-2-8)

2.1 Taxiing to/from stands

Taxiing route offering the most efficiency will be utilised from the East Terminal to depart RWY 11.

Departing aircraft may be instructed to vacate the RWY at TWY C and hold at TWY A, pending take-off clearance from ATC.


TTCP AD 2.23 ADDITIONAL INFORMATION (Page AD 2.10-2-11)

2. The two (2) Terminal Buildings and two (2) Aprons are referred to as East Terminal and West Terminal, and East Apron and West Apron.

Please amend Eastern Caribbean AIP pages AD 2.10-2-2, AD 2.10-2-3, AD 2.10-2-5, AD 2.10-2-6, AD 2.10-2-8, AD 2.10-2-11 and AD 2.10-2-13.

AIP SUP 35/26 replaces AIP SUP 32/26

END

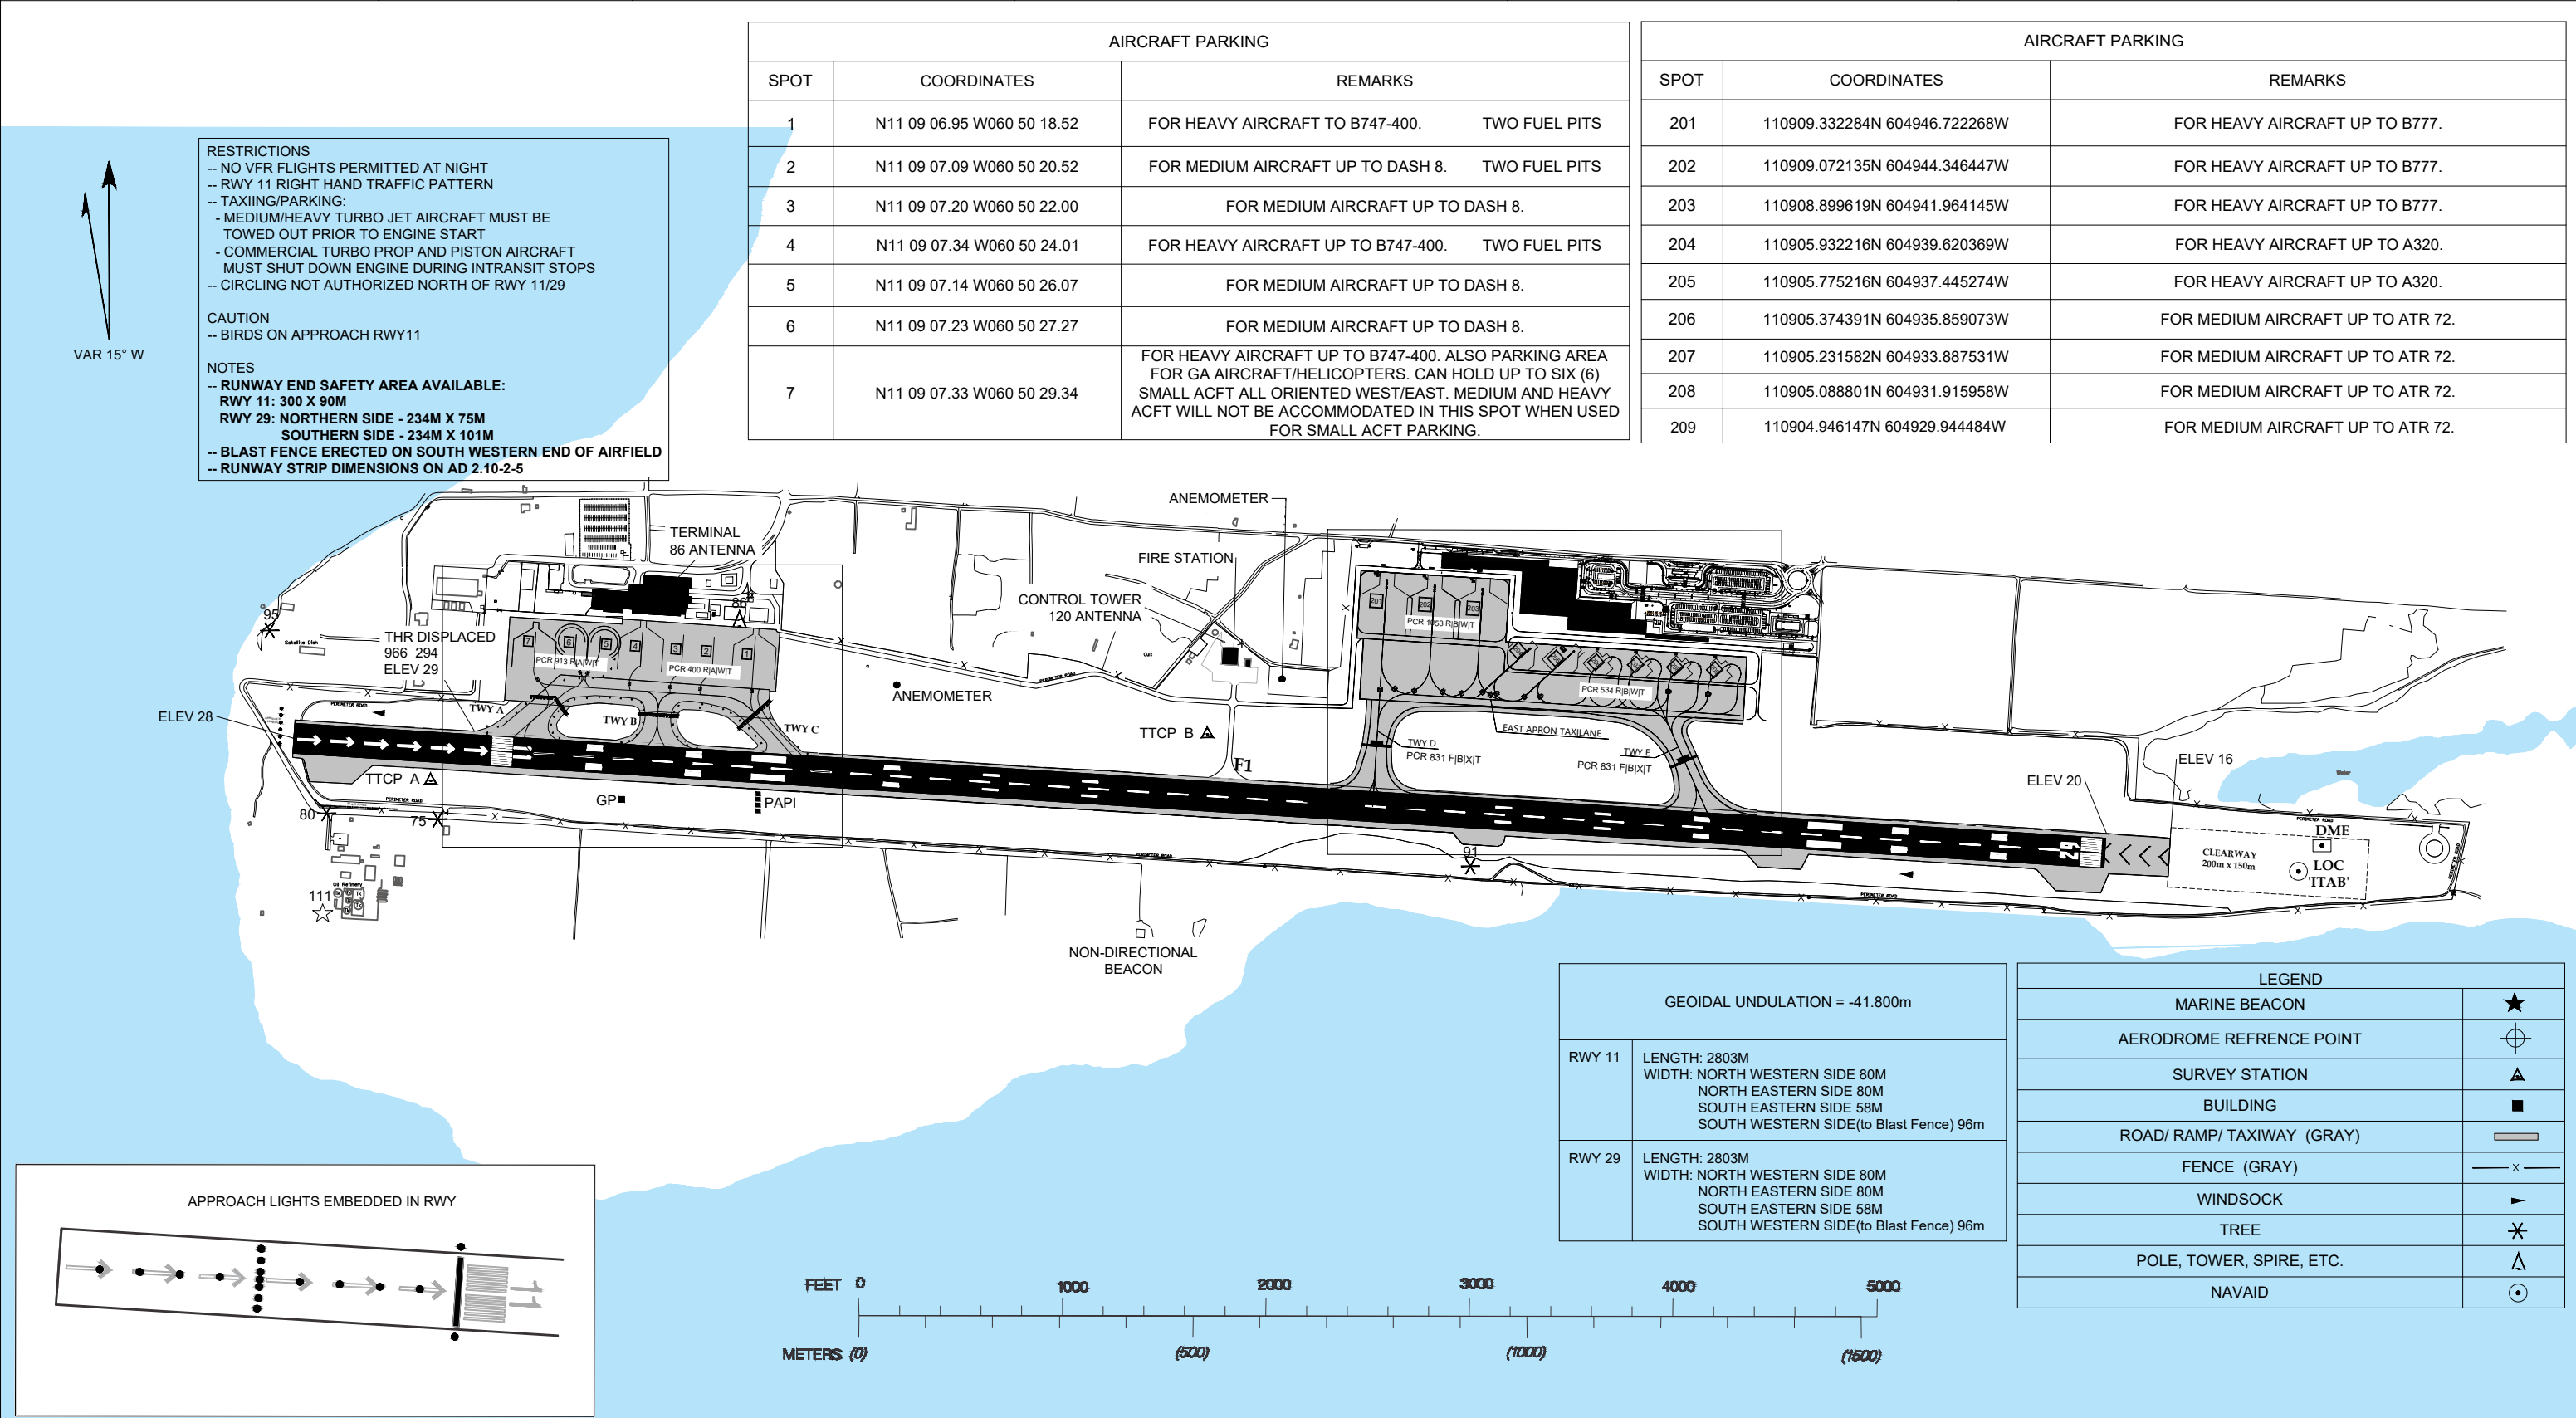

Intentionally left blank